

Work in focus - Brgy. 7 – Lipa City

Completion of 7 new electricity masts is deficient.



For approx. 3 months ago, a contractor finished work on new sewer pipes in the sidewalks.

Approx. 1 month later the power supply came and moved the 10 kV wires from right to left side of the road.

The work is assessed according to 3 criteria: Placed outside pipes, re-establishment and clean-up.

Placed outside pipes: Inside means that the mast can stop water flow in the pipe by up to 50%.

Re-establishment: Indicates whether filled or cast around the mast.

Clean-up: This means whether the excess materials have been removed from the work.

Status of errors out of 7 possible: Placed in Pipes = 4 Re-establishment = 3 Clean-up = 6

<http://www.uriarte.ph/focus/electrical-mast.pdf>



Photo 1

Mast 1

Placed outside pipes: No

Re-establishment: Yes

Clean-up: No



Photo 2

Mast 2

Placed outside pipes: No

Re-establishment: No

Clean-up: No



Photo 3

Mast 3

Placed outside pipes: Yes

Re-establishment: Yes

Clean-up: No



Photo 4

Mast 4

Placed outside pipes: No

Re-establishment: No

Clean-up: No



Photo 5

Mast 5

Placed outside pipes: Yes

Re-establishment: Yes

Clean-up: No



Photo 6a

Mast 6

Placed outside pipes: No

Re-establishment: No

Clean-up: Yes



Photo 6b

Mast 6

Placed in the middle of the pipe!



Photo 7

Mast 7

Placed outside pipes: Yes

Re-establishment: Yes

Clean-up: No